

Tacho Generator repair. Sep 2020

The plain bearing bush tends to migrate into the body of the generator, thus allowing the driving dog to disengage resulting in no reading on the tacho.

This was fixed by pulling the dog outwards until the bush was in its correct axial location and then fixing with a 3/32 spring pin. The pin hole was drilled 0.22" deep so that it would not contact the shaft.

