

Brief notes and technical information tips about Jaguar products

Models – S-TYPE 2003 MY/ XJ 2004 MY

Symptom: Steering Column Configuration

Information: Please be aware that when replacing the IPK and/or steering column you must **only** use the sequence found on top the steering column, as shown in bulletin S413-02. There is **NO** one sequence that will work on all cars, and it will only be a matter of time before lockout will occur if "Generic" sequence is used as a time saving measure. If the sequence is entered incorrectly the WDS will display error 4-35 and the steering column movement will be disabled in the ECM VID block. To reverse this error 4-35, reinstall original IPK, configure the ECM as new, reinstall new IPK, configure as new with correct sequence, retest and if fault still present, contact Technical HelpLine. The VID Block may need to be corrected manually (more details regarding VID block can be found in FAQ 9041). Please be aware that 2004 S-TYPE and 04MY XJ, will now have the number located in trunk to avoid having lowering column to access correct sequence.

Models – X TYPE – Job 1

Information: When addressing concern of X-TYPE demister grilles popping out and or rattling, replace grille/grilles with the following updated part #'s:

C2S-36956 + COLOR Code (left hand grille)

C2S-36957 + COLOR Code (right hand grille)

C2S36958 + COLOR Code (end caps)

An engineering change has been made to the grilles, which improves retention to the facia

Models – XJ Series 2004 MY

Symptom: Power Windows/Door Lock Operation

Information: When addressing a concern of power windows, door locks inoperative, and rear window lock out switch led is flickering, check the power and ground to the DDM. If there is no fault found, do not swap out the DDM from a known good car. If a DDM was fitted from a known good vehicle, the windows and locks will operate, but the door locks will not unlock when the alarm system is active, you will not be able to communicate with any of the modules or code remotes and the alarm will sound. To rectify the situation, once the power/grounds have been verified, use WDS disc 26 to connect to the vehicle but select "NO" when asked to read the configurations from the vehicle. When vehicle configuration comes up, there will not be any any configuration data showing on WDS. Manually input the known configuration for the vehicle and then you should be able to configure the car.

December TSB Summary:

Service Bulletin Listing

Number	Technical Bulletin Title	Model	VIN	Date
XT204-07	Vehicle Drifts Left Or Right With Brakes Released - Diagnosis	X-TYPE	C00001-ON	12/03
XT303-11	Check Engine MIL/DTC P0341 And P1341 - V6 Engine - Repair Procedure	2002 MY-ON X-TYPE	C00001-ON	12/03
XT310-02	Fuel System - Drivability/Starting Issues - Customer Complaints - Diagnostic Procedures	X-TYPE	C00001-ON	Amended 12/03
XT310-03	Fuel Tank Removal/Installation - Revised Procedure	X-TYPE	C00001-ON	12/03
S501-22	Shield For Roof Opening Panel Slides Forward While Braking - Loose Fit - Install Velcro Strips	2003 MY S-TYPE	M44998-M80185	12/03

Number	Administration Bulletin Title	Model	Date
1-167	Mandatory Special Tool - 303-1077	ALL	12/03
1-166	WDS Software JTP 759 CD 27	ALL	12/03

Product Investigation Technical Emails

Subject	Model	Date
Vibration From Driveshaft	2004 MY X-TYPE	12/04/2003
New DTC's For 2004 MY	2004 MY All	12/16/2003
No Satellite Signal/Display Defaults to 12:00	XK8	12/15/2003
New Map Disc Release	04XJ, 03S TYPE & 03X TYPE	12/23/2003

Missing a Bulletin? You can find it on JBNONLINE.

Note: When contacting the Technical Hotline, please be sure to have your pre-call worksheet filled out prior to contacting us. The more information you have at hand will shorten the time necessary to discuss and rectify your concerns