



TechLines

August 2003

Brief notes and technical information tips about Jaguar products

Models – S-TYPE 2000-02MY

Information: Instrument Pack (IPK) Programming

Programming of a new IPK can be performed without hooking up WDS and/or PDU. You will need to cycle the two known good keys within five seconds to complete programming process.

Models – XJ 2004MY

Information: Telephone Installation

When installing phone and/or voice without rear entertainment, be aware that the D2B connection labeled BT-INLINE (used for rear entertainment) will need to remain capped for the D2B to continue its loop back to the audio unit.

Models – XJ/XK AJ26

Information: Please be aware that when ordering replacement heads for a AJ26 engine that the heads have been superseded to AJ27 heads and the tappets will have to be replaced with a AJ27 tappets. This will be necessary to gain proper valve clearance.

Models – XJ 2004 MY

Symptom: Rear Entertainment

Information: When diagnosing customer concerns with rear entertainment, it would be advisable to perform a complete system functional check, with the help of the operator's manual. Be aware that if the customers complaint can be duplicated, please go to section 415 in JTIS to assist in diagnosis of rear entertainment systems.

Models – S-TYPE 2003 MY-ON

Symptom: A/C System Lock Up

Information: Be aware that if you are diagnosing customer complaint of climate control lockup, you will need to complete and submit checklist, which can be found attached to FAQ 8661.

Models – X-TYPE 2002 MY Onwards

Symptom: Check Engine Warning Code P1611

Information: When diagnosing Code P1611 (ECM sub CPU failure) with no fault found and/or with no other relative codes stored. Reconfigure / reflash the ECM with VER 24A or higher, will eliminate the false flagging of this code. Visit FAQ 7741 for safe VIN range.

**Send your tip suggestion for TechLines to rhashway@jaguar.com
(FAX to TechLines Editor at 201 818 8478)**

August TSB Summary:

Service Bulletin Listing

Number	Technical Bulletin Title	Model	VIN	Date
307-14	Shift Quality Issues/Harsh Engagement With Engine Cold - ZF 5HP26 - Install New Transmission Control Module	2000-02 MY XK Range 2000-03 V8 XJ Series	A00083-A30644 F00103-F59525	08/03
S303-S157	Vehicles With 3.0L V6 Exchange Engines - Potential Thrust Bearing Failure - Service Action S157	2000-03 MY 3.0L S-TYPE	L00001-M50849	08/03
XJ307-2	Driveline Clunk/Knock When Downshifting - ZF 6HP26 Automatic Transmission - Repair Procedure	XJ	G00001-ON	08/03
XJ307-1	MIL Illumination - DTC P0741 - Replace Torque Converter	XJ8 XJR	G00442-G01790 G00442-G05142	08/03
204-S499	Lower Wishbone Front Bushing - Change Of Specification - Service Action S499	XK V8 XJ Series	034426-A06104 862295-F11235	08/03

Number	Administration Bulletin Title	Model	Date
3-181	Jaguar Repair Time Searcher (RTS) - NAS - Version 001	1995 MY-ON	07/03
6-104	VIN and Certification Plates / Labels - Location / Replacement	All	08/03
3-180	No Fault Found Policy	All	06/03

Product Investigation Technical Emails

Subject	Model	Date
Harsh or Firm Ride/Low Ride Height	2004 MY XJ range	07/29/2003
Ignition Coil Ground Information Incorrect	2004 MY XJ range	07/23/2003
Tool for Camshaft Sprocket Retaining Bolt	V8 Engine from engine no. 0108130000 on	08/6/2003
Warning Lamp Operation Questionnaire	2003 MY S-TYPE M45978 on	07/29/2003
Actions To Be Taken In Case of A/C Compressor Failure	2004 MY XJ	08/8/2003
Poor radio Reception	2004 MY XJ range VIN G08125-G10055	08/8/2003

Missing a Bulletin? You can find it on JBNONLINE.

Note: When contacting the Technical Hotline, please be sure to have your pre-call worksheet filled out prior to contacting us. The more information you have at hand will shorten the time necessary to discuss and rectify your concerns.