

Brief notes and technical information tips about Jaguar products

Models: S TYPE 2003 MY Onwards
Symptom: High Quiescent Draw

Information: If you are experiencing a high quiescent draw, or the vehicles alarm is going off by itself at about the 45-minute mark, first make sure the battery is fully charged. Then please check the voltage to the RECM at the CA101-3 pin, and make sure its voltage is the same as the battery voltage. If it is not, then check the resistance at connector FH1-1, if this pin has plastic flashing causing poor resistance, the timing circuit for the modules to sleep will be hindered, and if the alarm is active, the GECM will notice a voltage drop across the RECM and will signal the alarm to go off.

Models: X TYPE 2004 MY Symptom: Pecus B warning

Information: If you have replaced the amplifier on a premium sound X-TYPE, and are now getting a PECUS B message on the IP, please use WDS version 28, and say "No" to reading the configuration information from the vehicle. When examining the audio configuration information for correctness, again say "No", and then select "Premium (Audiophile)", and then confirm it. Then the WDS should give you the option of configuring the amplifier, in which case your PECUS B message should disappear.

Models: S TYPE 2003 MY Onwards

Symptom: Check Engine MIL with DTCs P0121, P0122, P0222, P1122, P1215, and/or P1344 **Information**: If a vehicle comes in with any of these DTCs, or any DTCs that relate to the 5-volt reference circuit, first check for shorts in the 5-volt reference circuit similar to X-TYPE bulletin XT303-06. The wiring harness for the accelerator pedal position sensor has been found to rub on the brake pedal assembly bracket near the APP sensor. Carefully investigate and repair this issue before proceeding with any other repairs. Also, on S-TYPE R, perform S159 for TPS water ingress as this could flag the same codes.

Models - XK8/XKR 2001/2002 MY

Symptom: PECUS D or PECUS P warning after replacing seat modules

Information: After replacing one or both seat modules, a technician will see a PECUS message on the dash. When looking on the WDS, there will be no programming option for the seat modules. To repair a tech must locate a 2003-04 XK, install the seat module in that vehicle, and then program with WDS. The only side that can be programmed is the driver's side; therefore a passenger seat module must be placed in the driver's position and programmed. After programming install modules in original car, PECUS message should be gone.

February TSB Summary:

Service Bulletin Listing

| Number | Technical Bulletin Title | Model | VIN | Date |
|------------|---|-------------------|---------------|-------|
| XT204-08 | Creaking Noise When Braking Over Speed Bumps - Front Control Arm Hydro bush - Replace Control Arm | X-TYPE | C00001-ON | 02/04 |
| XT501-S948 | Front Seat Stabilization Kit - Change Of Specification - Service Action S948 | 2002-03 MY X-TYPE | C00294-D19415 | 02/04 |
| | Front Control Arm Removal/Installation - Revised Workshop Procedure - Not On JTIS | X-TYPE | C00001-ON | 02/04 |
| XJ501-07 | Entry Of Water Into Vehicle - Possible Sources | XJ | G00001-ON | 02/04 |
| | Oil Cooler Pipe Interference With Cross Brace - Service Action S 717 | XJR | G00442-G22995 | 02/04 |

| Number | Administration Bulletin Title | Model | Date |
|--------|--|-----------------------|-------|
| 6-111 | Transmission HelpLine - New Policy - Mandatory Form Submission Prior To Contact | ALL | 01/04 |
| 1-154 | Availability Of Portable Test Unit (PTU) Kit As Supplement To WDS - Limited Availability | ALL | 01/04 |
| 3-185 | Free Scheduled Maintenance Program - 2004 MY Vehicles | 2004MY | 01/04 |
| 3-186 | Complimentary Oil Change - Select Edition Program | All Select Edition | 01/04 |

| FAQ'S | | | | | | |
|---|----------------------------|------------|--|--|--|--|
| Subject | Model | Date | | | | |
| FAQ-12161 P1727 W5A-580 Transmission | XJ / XK | 02/26/2004 | | | | |
| FAQ-12121 Condenser Leak Path (X202) | S-TYPE | 02/25/2004 | | | | |
| FAQ-12041 VID Block up load CD25 or Later | S TYPE / X TYPE XJ / XK | 02/24/2004 | | | | |
| FAQ-12021 Audio Speaker Malfunction | XJ | 02/24/2004 | | | | |
| FAQ-2781 V6 Flagging DTC's P1383/P1388 | S TYPE | 02/24/2004 | | | | |
| FAQ-11861 Navigation – Telematics Diagnostics | S TYPE / X TYPE XJ | 02/23/2004 | | | | |

Missing a Bulletin? You can find it on JBNONLINE.

<u>Note:</u> When contacting the Technical HelpLine, please be sure to have your pre-call worksheet filled out prior to contacting us. The more information you have at hand will shorten the time necessary to discuss and rectify your concerns