



XK

DATE 06/02

415-09

**SERVICE**

**TECHNICAL BULLETIN**

**Premium Sound System - Poor Mid-Range Speaker Performance – Incorrect Speakers Installed – Replace Speakers**

MODEL 2000-02 MY  
XK Range  
VIN A00116-A30644

**Issue:**

On some 2000-02 MY XK Range vehicles, within the above VIN range, customers may complain that the front fascia speakers have poor sound quality (excessive high frequency ‘tinny’ sound) with very little mid-range.

On some vehicles it has been found that 31 mm non-premium audio system tweeters have been installed in the fascia instead of the correct 65 mm mid-range premium audio system speakers. The size and type of speakers (tweeters) should be checked and if it is found that 31 mm non-premium sound tweeters are installed these should be replaced with the correct 65 mm mid-range premium speakers.

**Action:**

On a customer complaint basis only, follow the workshop procedure outlined below:

**WORKSHOP PROCEDURE**

1. Remove fascia speaker grilles and check size of speakers installed (should be 65 mm mid-range).
2. If correct 65 mm mid-range speakers are installed, re-install fascia speaker grills.
3. If 31 mm non-premium tweeters are installed, install new fascia 65 mm mid-range speakers (see Workshop Manual, JTIS CD ROM, section: 415-03).

**Parts Information:**

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY.</u>
65 mm mid-range premium sound speaker	LJA 4140AA	2

**Warranty Information:**

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number	Causal Part Description
Check and install 65 mm mid-range premium sound speakers	86.51.02	0.2 hrs.	LJA 4140AA	Non-premium speaker

