


Connector: **C44-C**

CONNECTOR HOUSING SERVICEABLE

Description: **Rear bumper harness to main harness**

Location: **Adjacent to spare wheel - LH side**

Qualifier:

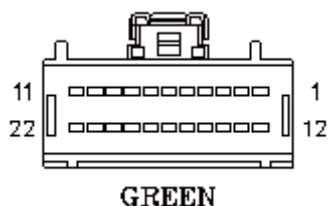


Part No.: **YPC900550**

Colour: **GREEN**

Cavities: **22WY**

Harness: **REAR BUMPER HARNESS**

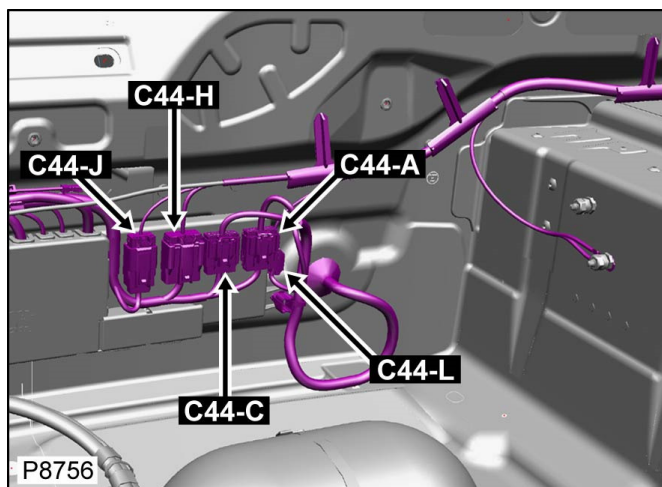

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WH-GN	ALL	C4LS35	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	BN-GN	ALL	C4LS35	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.75	WH	CBGAG	C4PK07	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.75	YE	CBGAG	C4PK07	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.75	WH-VT	ALL	C4PL18	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.75	YE-BU	ALL	C4PL18	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.35	VT-BN	HLLAC	C44-M	-	-	-	-	-	-	-
9	0.75	YE	HLLAC	S/JOINT SPL203	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.75	YE	HLLAA	C44-C	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.75	YE	HLLAC	S/JOINT SPL204	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.75	YE	HLLAA	C44-C	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.5	GY-OG	ALL	C4LS35	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.35	WH-OG	ALL	C4LS35	-	-	-	-	-	-	-
14	0.35	YE	ALL	C4LS35	-	-	-	-	-	-	-
16	0.35	BU-BN	HLLAC	C44-M	-	-	-	-	-	-	-
17	0.35	YE-GN	HLLAC	C44-N	-	-	-	-	-	-	-
18	0.35	WH-GN	HLLAC	C44-N	-	-	-	-	-	-	-
19	0.75	YE	HLLAC	S/JOINT SPL205	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.75	YE	HLLAA	C44-C	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.75	YE	HLLAC	S/JOINT SPL206	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.75	YE	HLLAA	C44-C	418-411-45	-	418-116A	418-117	-	418-112	

											418-107
21	0.75	GY	J3KAB	C4MP19	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.75	WH-BU	J3KAB	C4MP19	418-411-45	-	418-116A	418-117	-	418-112	418-107