

V8 XJ Series

DATE 3/99

501-30

SERVICE

TECHNICAL BULLETIN

Installation of Child Seat Tether Mounting Eyes – Dimensions – USA Vehicles MODEL 1998 MY-ON V8 XJ Series

VIN

812256-ON

Issue:

Threaded inserts are present under the rear shelf area of all 1998 MY-ON V8 XJ Series. This bulletin outlines a procedure for locating the insert on USA market vehicles to permit installation of the child tether restraint eyelet kit at customer expense.

Action:

VEHICLES EQUIPPED WITH HARMON/KARDON SOUND SYSTEM

The rear shelf is covered by a soft padded insert that includes the grille for the subwoofer. On these vehicles, feel through the padded insert until the existing openings in the rear shelf are located (refer to illustration 1). Verify the location(s) that the customer desires for the tether mounting(s). Cut the soft pad with a sharp knife such as an Xacto. Install the tether eye kit in the desired position(s).

VEHICLES EQUIPPED WITH STANDARD SOUND SYSTEM

No openings are present in the rear shelf of these vehicles. As a result the shelf should be

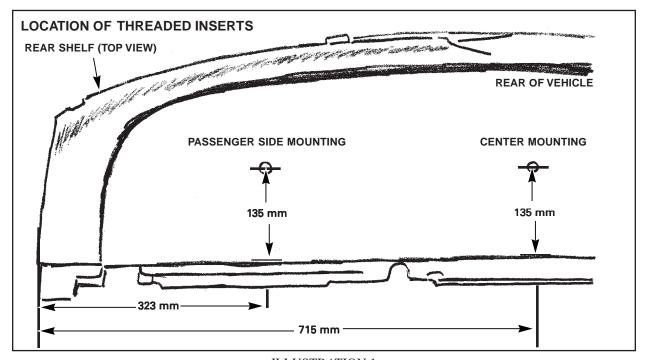


ILLUSTRATION 1



removed to cut holes in the desired locations. For instructions on removing the rear shelf, refer to JTIS, Body & Paint, 501-05: Trim and Ornamentation Interior, Removal and Installation, Rear Parcel Tray (76.67.06.90). To determine where to cut the openings, measure according to the dimensions shown in Illustration 1. (The passenger side dimensions are also valid for the driver side mounting.) Verify the location(s) the customer desires for the tether mounting(s). Center punch and cut a 19 mm hole in the rear shelf using a hole saw. Reinstall the rear shelf. Install the tether eye kit in the desired position(s).

Parts Information:

DESCRIPTION

Tether mounting eye kit

PART NUMBER

HJA 2100AA

QTY

1 per child seat

