Brake System Bleeding Vehicles With: Brembo Brakes

1. WARNING:

IF BRAKE FLUID IS TAKEN INTERNALLY, DRINK WATER AND INDUCE VOMITING. GET MEDICAL ATTENTION IMMEDIATELY.

WARNING:


WASH HANDS AFTER HANDLING BRAKE FLUID. IF BRAKE FLUID COMES INTO CONTACT WITH THE EYES, FLUSH EYES WITH COLD RUNNING WATER. IF IRRITATION PERSISTS SEEK MEDICAL ATTENTION.

A CAUTION:

Remove brake fluid spillage immediately from paint work with clean water.

Position vehicle on a four-post lift.

2. Open engine compartment and fit paint work protection covers to fenders.

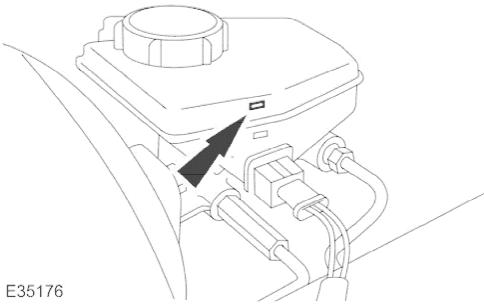

3. **NOTE**:


Make sure the brake-fluid level does not fall below the fluid reservoir 'MIN' (minimum) mark when bleeding the brake system.

1


Fill fluid reservoir to the 'MAX' (maximum) mark.

2012-02-18

2004 XK RANGE - Brake System - General Information - 206-00

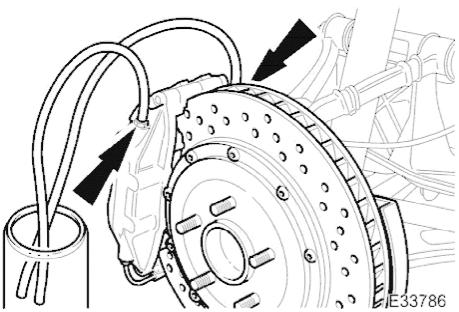


- 4. Prepare the left-hand front, brake-caliper for bleeding.
 - Connect bleed pipes and fluid containers to bleed nipples.
- 5. Bleed the brake.
 - 1. Apply pressure to brake pedal.
 - 2. Open caliper's outer bleed nipple.
 - 3. Fully depress brake pedal.
 - 4. Close bleed nipple.
 - 5. Release brake pedal.
 - 6. Wait two seconds to allow system to prime.
 - 7. Repeat procedure until air-free brake fluid is expelled from the bleed nipple.
 - 8. Repeat procedure to caliper's inner bleed nipple.

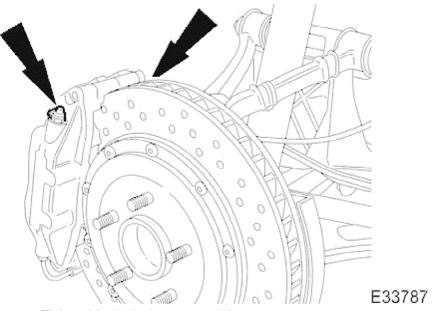


6. Tighten bleed nipples to 12-16 Nm.

2012-02-18

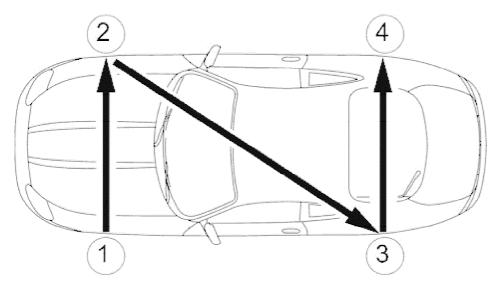

E35183

- 7. Following the procedure above, bleed the brakes in the order shown:
 - 1. Left-Hand Front,
 - 2. Right-Hand Front,
 - 3. Left- Hand Rear,
 - 4. Right-Hand Rear.

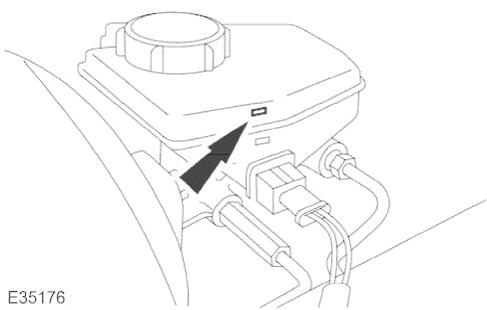

8. CAUTION:

Remove brake fluid spillage immediately from paint work with clean water.

Fill fluid reservoir.

- Fill reservoir to the 'MAX' mark.
- Fit filler cap.
- 9. Start engine.
- 10. Check for correct brake-pedal travel and pressure.

3 2012-02-18

2004 XK RANGE - Brake System - General Information - 206-00

11. Apply brake pedal and check around vehicle for brake fluid leaks.

Make sure brake fluid level is at the 'MAX' mark.

4 2012-02-18