


Connector: **CAPW02A**

CONNECTOR HOUSING NOT SERVICEABLE

Description: **Module-Driver door**

Location: **Behind driver door trim panel**

Qualifier:




Part No.: **YPC908660**

Colour: **BLACK**

Cavities: **22WY**

Harness: **DRIVER DOOR HARNESS**

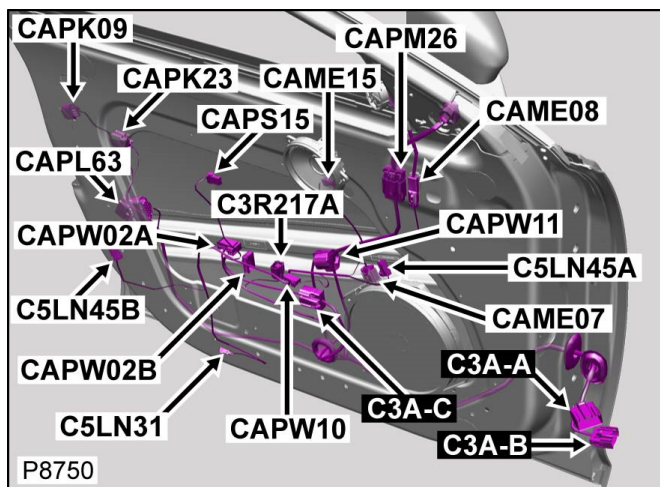

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	BU	ALL	CAPW11	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	BU	ALL	C3A-B	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	YE	ALL	C3A-C	-	-	-	-	-	-	-
5	0.35	BU	ALL	CAPW11	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	BU	ALL	CAPW11	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	BU	DR_D	CAPL63	-	-	-	-	-	-	-
7	0.5	BU	DR_B	CAPL63	-	-	-	-	-	-	-
9	0.5	BU	CBAAD	CAPL63	-	-	-	-	-	-	-
10	0.5	BU	DR_D	CAPL63	-	-	-	-	-	-	-
10	0.5	BU	DR_B	CAPL63	-	-	-	-	-	-	-
12	2.5	BU	ALL	CAPW11	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
13	2.5		ALL	C3A-B	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
15	0.35	BU	DR_D	CAPL63	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	BU	DR_B	CAPL63	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	BU	ALL	CAPW11	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	BU	ALL	CAPW11	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	BU	ALL	S/JOINT SPL217	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.35	BU	ALL	CAPL63	418-411-45	-	418-116A	418-117	-	418-112	418-107